


(Return) Figure 3

Vacusmale alemanner.com

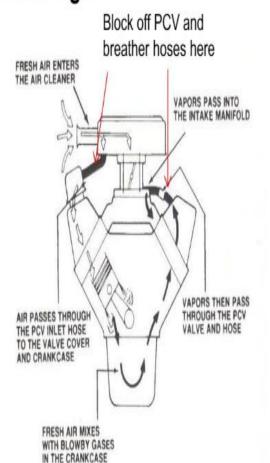


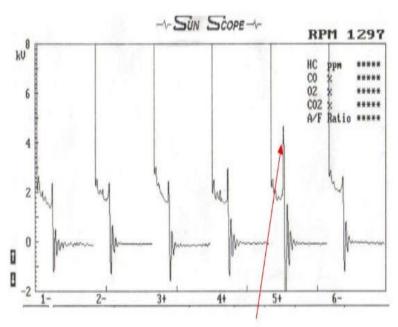

1997 Intrepid 3.5 with a PO305 DTC. Lean misfire caused by vacuum leak at #5 intake runner.

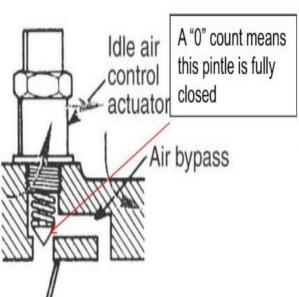

Throttle

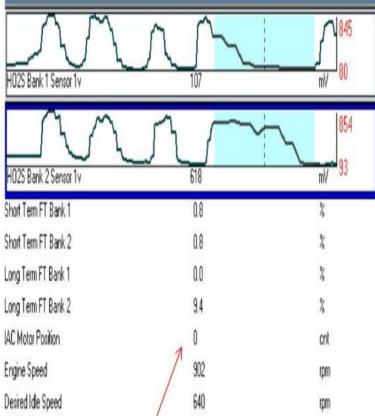

Vacuum leak on bank 2, causing a 0 IAC count and an RPM that is higher than desired idle speed. This car had no lean exhaust DTCs but did have an idle adaptive limit code.